

Date: Monday, 6/5/2006 7:28:32 AM
 User: Kim Johnston

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : 206 L HIGH GEAR SKIDTUBE
 Job Number : 27335A
 Estimate Number : 10539
 P.O. Number : N/A Part Number : D206642341
 This Issue : 6/5/2006 S.O. No. : N/A Drawing Number : D2650 REV E
 Prsht Rev. : NC Project Number : N/A
 First Issue : N/A Type : LANDING GEAR Drawing Revision : E
 Previous Run : 27203A Material : N/A
 Due Date : 6/30/2006 Qty: 1 Um: Each
 Written By :
 Checked & Approved By :
 Comment : Est Rev: H 05.10.11 Added D3429-1 per CHG004 KJ/CP/JLM

Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 DC DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy bluefile and create labels per PPP D206-642-341 CHG002

RT 06.06.19

2.0 D2620 Bent 206 Skidtube



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch
 1 D2620 Bent Tube 3" OD B27831

DP 6-7-10

3.0 D2647 Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch
 1 D2647 Fwd Cap B24842

BE 6-7-12

4.0 LANDING GEAR 1 LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr Fwd edge of tube

2-Remove ridge on inside of Fwd edge of tube as per Dwg D2650

3-Weld Fwd Cap as per Dwg D2650. Use aluminum rod. Grind D2647 to fit as required.

A/R Aluminum Rod M100660/M18839 BE 6-7-12

4-Grind weld flush to cap on top surface only. BE 06-07-12

> DP 6-7-10

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

NOTE: Date & initial all entries

QA: N/C Closed: _____ Date: _____

Date: Monday, 6/5/2006 7:28:33 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 27335A

Part Number: D206642341

Job Number:



Seq. #:

Machine Or Operation:

Description :

5-Cut aft end to length as per dwg D2650

BE 06-07-12

6-Drill pilot holes using drill Jig DT8168A (A, & B). Open to Ø0.312"

BE 06-07-13

7-Drill holes for wearplates using DT 8028-5. Open to Ø0.297"

BE 06-07-13

8-Open Aft Cap Hole using #6 Drill Bit

BE 06-07-13

9-Open holes for Tow Ring to Ø0.625" as per Dwg D2650, D2650-5 Drilling Detail

BE 06-07-13

10-Remove inner indexing ridge on aft end of skidtube as per Dwg D2650

BE 06-07-13

11-Deburr and Blow out all chips from inside the tube

BE 06-07-13

5.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

Pm 06-07-14 (1)

6.0

D26545

206 L Beam (Web)



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2654-5

Web

B21093

Pm 06-07-14 (1)

7.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open holes to finished size as per Dwg D2650, D2650-5 Drilling Detail (without cutting fluid)

Pm 06-07-14 (1)

2-Countersink crossbolt spacer holes as per Dwg D2650 (without cutting fluid)

Pm 06-07-14 (1)

3-Deburr. Blow out chips. Grind alodine off around crossbolt spacer.

Pm 06-07-14 (1)

4-Bond D2654-5 web in place as per QSI 015 Ensure holes line up Allow 12 Hrs. cure time before cutting

Start Date: 06-07-14 Time: 6:45

Finish Date: 06-07-18 Time: 11:00

A/R Sikaflex-291 m101193

Sikaflex expiry date: 06-11-01

Pm 06-07-14 (1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

NOTE: Date & initial all entries

QA: N/C Closed: _____ Date: _____

Date: Monday, 6/5/2006 7:28:33 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 27335A

Part Number: D206642341

Job Number:



Seq. #:

Machine Or Operation:

Description :

8.0

QC5

INSPECT WORK TO CURRENT STEP



Jan 18 ①



Comment: INSPECT WORK TO CURRENT STEP

9.0

D2649

Crossbolt Spacer



Comment: Qty.: 17.0000 Each(s)/Unit Total : 17.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

17 D2649

Crossbolt spacer

B25864

BE 06-08-09 ①

10.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Insert cross bolt spacers D2649. Weld as per QSI 004 and Dwg D2650. Remember to back drill each hole to 0.25" before welding the other side. Use aluminum rod.

A/R

Aluminum Rod

M18839

BE 06-08-09 ①

2-Grind welds flush as per Dwg D2650. Masking Tape access to inside of the Skidtube

BE 06-08-09 ①

3-Counterbore 5/16" x 0.750" deep as per Dwg D2650Deburr

BE 06-08-09

11.0

D2680041

Nut Plate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2680-041

Nut Plate

B24203

DP 6-8-11

12.0

CCR264SS33

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

2 CCR264SS3-3

Rivets

M18548

DP 6-8-11

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

NOTE: Date & initial all entries

QA: N/C Closed: _____ Date: _____

Date: Monday, 6/5/2006 7:28:33 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 27335A

Part Number: D206642341

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

M7885343

Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number

Description Batch

2 M7885/3-4-3

Rivets

419099 DP 6-8-11

14.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Install D2680-041 Nut Plate as per Dwg D2650

DP 6-8-11

15.0

QC5/9

WELD INSPECTION



Comment: WELD INSPECTION

06-08-15 (1)

PD 06-08-21 (1)

16.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White (Ref. 4.3.5.1) as per QSI 005 4.3

Make sure Nut Plate Thread protected use paint screw

a.m 06-09-05 (1)

17.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

DL 06/09/05 (1)

18.0

D26483

Wearpad



Comment: Qty.: 6.0000 Each(s)/Unit Total : 6.0000 Each(s)

Pick:

Qty Part Number

Description Batch

6 D2648-3

Wearpad

DL 116357 M27162-2

19.0

D265611

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2656-11

Wearshoe

116357

DL 06/09/05 (1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

NOTE: Date & initial all entries

QA: N/C Closed: _____ Date: _____

Date: Monday, 6/5/2006 7:28:33 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 27335A

Part Number: D206642341

Job Number:



Seq. #:

Machine Or Operation:

Description :

20.0

D265623

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2656-23

Wearshoe

B2Y84G

21.0

D265635

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2656-35

Wearshoe

B2533C

22.0

D34291



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D3429-1

Wearpad

B24417

23.0

ALS41032130

Insert



Comment: Qty.: 54.0000 Each(s)/Unit Total : 54.0000 Each(s)

Pick:

Qty Part Number

Description Batch

54 ALS4-1032-130

Inserts

M19393

or (see QSI 017)

check X

24.0

AN960JD10L

Washer



Comment: Qty.: 54.0000 Each(s)/Unit Total : 54.0000 Each(s)

Pick:

Qty Part Number

Description Batch

54 AN960JD10L

Washer

M100233

DL 06/09/05 (1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

NOTE: Date & initial all entries

QA: N/C Closed: _____ Date: _____

Date: Monday, 6/5/2006 7:28:33 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 27335A

Part Number: D206642341

Job Number:



Seq. #:

Machine Or Operation:

Description :

25.0

MS27039108

Screw



Comment: Qty.: 54.0000 Each(s)/Unit Total : 54.0000 Each(s)

Pick:

Qty Part Number

Description Batch

54 MS27039-1-08

Screw

M19551

X

26.0

D26511

Plug



Comment: Qty.: 14.0000 Each(s)/Unit Total : 14.0000 Each(s)

Pick:

Qty Part Number

Description Batch

14 D2651-1

Plugs

B27362

27.0

D26513

O-Ring



Comment: Qty.: 14.0000 Each(s)/Unit Total : 14.0000 Each(s)

Pick:

Qty Part Number

Description Batch

14 D2651-3

O-Rings

B25866

28.0

AN960JD416

Washer



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 AN960JD416

Washer

PL
M6874

M11151

29.0

MS27039406

Screw



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 MS27039-4-06

Screw

PL
M6874

M11151

PL

06/09/05 ①

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

NOTE: Date & initial all entries

QA: N/C Closed: _____ Date: _____

Date: Monday, 6/5/2006 7:28:33 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 27335A

Part Number: D206642341

Job Number:



Seq. #:

Machine Or Operation:

Description :

30.0

D2646

Aft Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2646

Aft Cap B28041

31.0

AN960JD10L

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number

Description Batch

2 AN960JD10L

Washer M100233

32.0

MS27039108

Screw



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number

Description Batch

2 MS27039-1-08

Screw M19551

X

PL 06/09/05 (1)

33.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install inserts & wearpads as per dwg D2922. Use a drop of Sikaflex inside insert holes before installing wearpad/wearplate.

A/R Sikaflex-291

M101953

Sikaflex expiry date:

10/06

2-Install O-Rings D2651-3 on plugs D2651-1 with Petroleum Jelly and install plugs as per Dwg D2650. Clean excess adhesive

3-Install MS27039-4-06 Screw as per DEO 9153

4-Inspect for foreign object per QSI 024

5-Install D2646 Aft Cap and seal with SikaflexClean excess adhesive

A/R Sikaflex-291

M101953

Sikaflex expiry date:

10/06

6-Wing Walk as per Dwg D2650-5 and QSI 005 4.4

Batch: M101667

a-m 06-09-06

(1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes (No) DQA: [Signature] Date: 06/09/19

NOTE: Date & initial all entries

QA: N/C Closed: _____ Date: _____

Date: Monday, 6/5/2006 7:28:34 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206 L HIGH GEAR SKIDTUBE

Job Number: 27335A

Part Number: D206642341

Job Number:



Seq. #:

Machine Or Operation:

Description :

34.0

QC3/5

INSPECT WORK/WING WALK



7609-13 (1)



Comment: INSPECT WORK/WING WALK

35.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and Stock

Location: _____

N/O 6/9/18

36.0

DC

DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Inspection Level 21

7609-13 (1)

Job Completion



W 06-4-18

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

NOTE: Date & initial all entries

QA: N/C Closed: _____ Date: _____

DESIGN <i>OP</i>		DRAWN BY <i>OP</i>		DART AEROSPACE USA, INC. PORT HADLOCK, WA	
CHECKED <i>PH</i>		APPROVED <i>[Signature]</i>		DRAWING NO. D2650 REV. E SHEET 1 OF 5	
DATE 06.03.30		TITLE 206/407 SKIDTUBE ASSEMBLIES		SCALE NTS	
A	97.03.25	NEW ISSUE			
B	97.06.26	AS MANUFACTURED CHANGES			
C	97.10.29	CHANGE HOLE PATTERN AND FRONT END			
D	04.05.17	REDRAW; INCORP. DE09136/9153/9163 MOD GROUND HNDLNG ON D2650-1/-3			
E	06.03.30	RMV C'BORE, CHG DRILL, ADD CHAMFER			

RELEASED

16 04 17

Qty -1	Qty -3	Qty -5	Qty -7	Part Number	Description
X				D2650-1	SKIDTUBE ASSEMBLY
	X			D2650-3	SKIDTUBE ASSEMBLY
		X		D2650-5	SKIDTUBE ASSEMBLY
			X	D2650-7	SKIDTUBE ASSEMBLY
1	1	1	1	D2600-1-160	EXTRUSION
1				D2654-1	WEB
	1			D2654-3	WEB
		1		D2654-5	WEB
			1	D2654-7	WEB
1	1	1	1	D2646	AFT CAP
1	1	1	1	D2647	CAP
16	17	19	23	D2649	CROSS BOLT SPACER
16	18	14	22	D2651-1	PLUG
16	18	14	22	D2651-3	O-RING
1	1	1	1	D2680-041	NUT PLATE
2	2			D3286-1	DOUBLER
2	2			D3286-3	STUD
42	44	54	60	ALS7-1032-130	INSERT (or AKS4-1032-130, ALS4-1032-130, ALS7-1032-130)
2	2	2	2	AN960JD10L	WASHER
2	2	2	2	CCR264SS3-3	RIVET
2	2	2	2	CR3212-4-03	RIVET
2	2	2	2	MS27039-1-08	SCREW
1	1	1	1	MS27039-4-06	SCREW
1	1	1	1	AN960JD416	WASHER
52	52			CR3212-4-04	RIVET



 


NOTES

- 1) WELD PER DART QSI 004
- 2) DAMAGE TOLERANCE ON FWD BEND:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 5 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020 DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150 IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
- 3) BOND WEB INTO OUTER TUBE WITH SIKAFLEX-241/-291 ADHESIVE PER DART QSI 015
- 4) INSERT D2651-1 PLUG C/W D2651-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE)
- 5) FINISH: -CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
-POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
-BLACK ANTI-SKID PAINT AS INDICATED TO 0.5 ABOVE LOCATION RIDGE PER DART QSI 005 4.4
- 6) DRILL Ø0.297 FOR ALS7-1032-130 INSERTS USING TEMPLATE DT8056-1 ON -1 TUBE, DT8056-3 ON -3 TUBE, DT8056-5 ON -5 TUBE, AND DT8056-7 ON -7 TUBE. INSTALL INSERTS AFTER FINISH.
- 7) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED




SHOP COPY
RETURN TO
HEIGHT OF 5
0.020 DEEP IN
0.015 ACCEPTABLE
5 SUBJECT TO AMENDMENT
(UBE) WITHOUT NOTICE
WORK ORDER
NO. 27335A

Copyright © 1997 by DART AEROSPACE USA, INC.



THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.		DESIGN 	DRAWN BY 	 DART AEROSPACE USA, INC. PORT HADLOCK, MA	REV. E
		CHECKED 	APPROVED 	DRAWING NO. D2650	SHEET 2 OF 5
DATE 06.03.30		TITLE SKIDTUBE		SCALE 1:10	

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 27335A

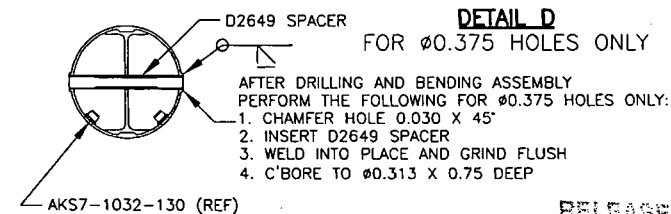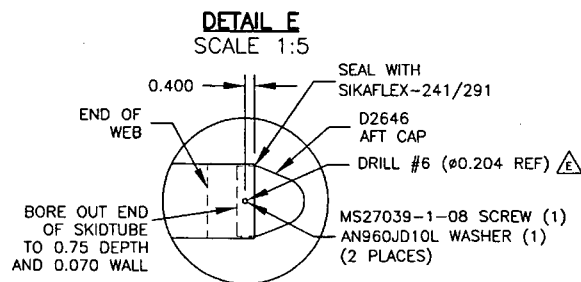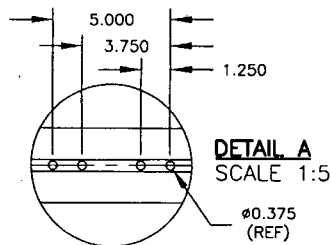


RELEASED
06.03.30

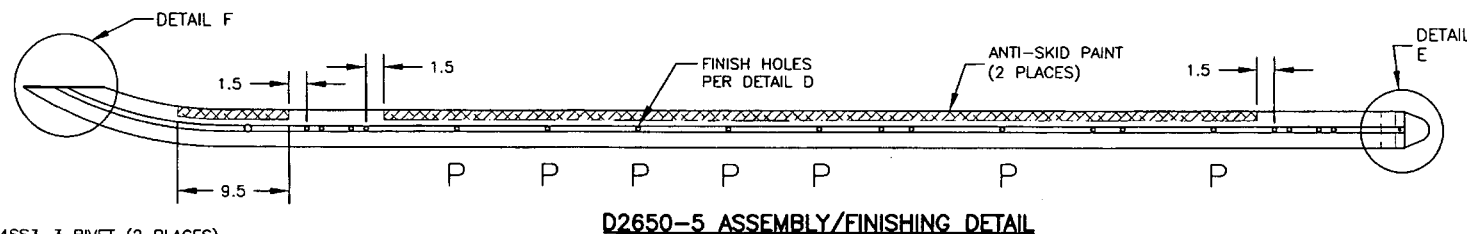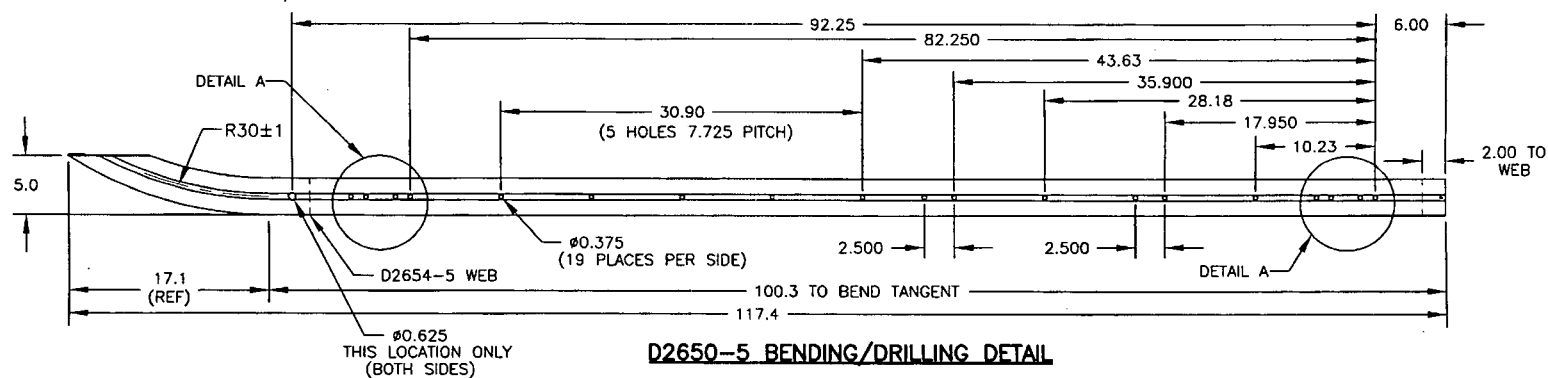

DETAIL F (NOT TO SCALE)

1. CUT TUBE LEVEL
2. REMOVE RIDGE ON FWD SIDE
3. LOCATE D2647 (TRIM AS NECESSARY)
4. WELD D2647 IN PLACE PER DART QSI 004
5. GRIND FLUSH
6. RIVET D2680-041 NUT PLATE IN PLACE






 
NOTE: MASK THREADS IN D2680-041 PRIOR TO FINISH



REMOVE RIDGE ON INSIDE OF SKIDTUBE LEAVE 0.070 MIN.

NO. 27335A
WORK ORDER
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
ENGINEERING
RETURN TO
SHOP COPY

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.		DESIGN	GP	DRAWN BY	GP	DART DART AEROSPACE USA, INC. PORT HADLOCK, WA	
CHECKED	PH	APPROVED	PH	DRAWING NO.	D2650	REV. E	SHEET 4 OF 5
DATE	06.03.30	TITLE	SKIDTUBE	SCALE	1:10		

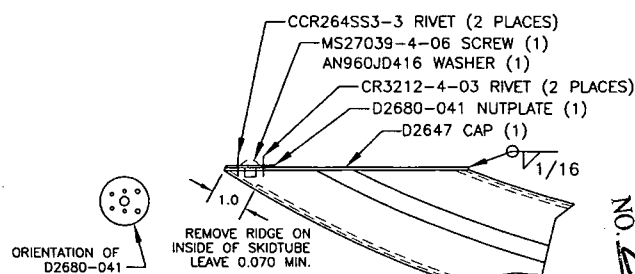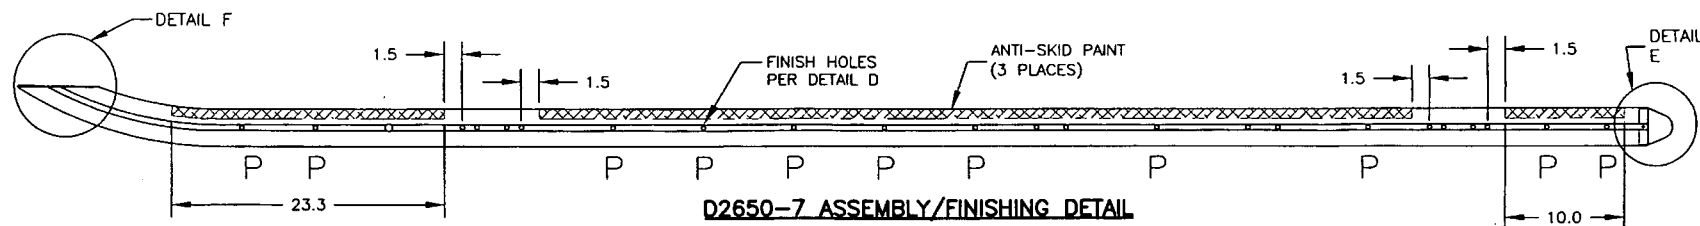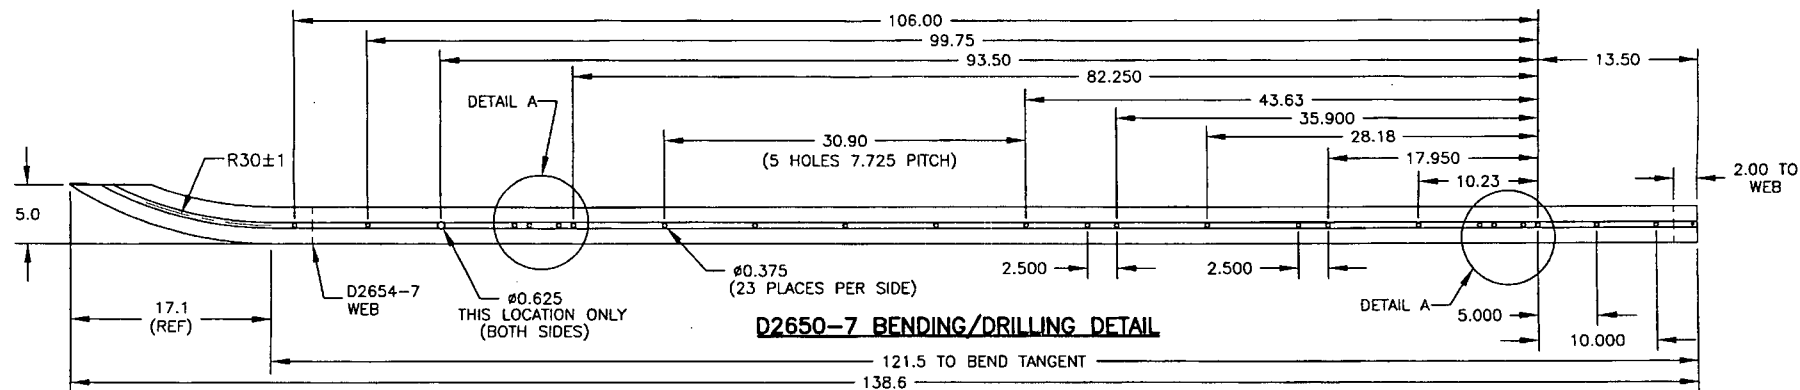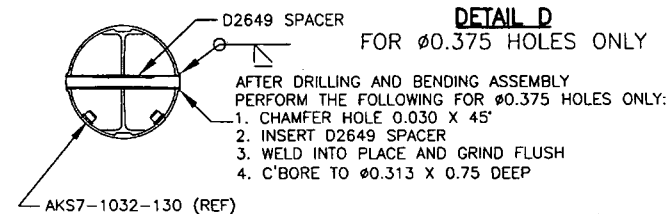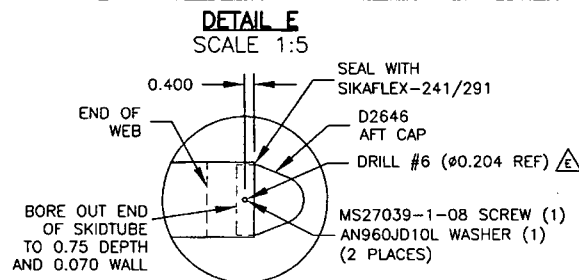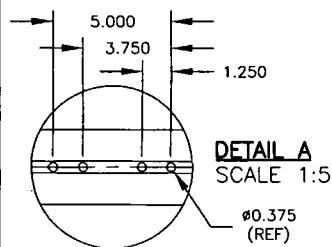

- DETAIL F (NOT TO SCALE)**
1. CUT TUBE LEVEL
 2. REMOVE RIDGE ON FWD SIDE
 3. LOCATE D2647 (TRIM AS NECESSARY)
 4. WELD D2647 IN PLACE PER DART QSI 004
 5. GRIND FLUSH
 6. RIVET D2680-041 NUT PLATE IN PLACE

NOTE: MASK THREADS IN D2680-041 PRIOR TO FINISH

NO. 27335A
WORK ORDER
CONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY
WITHOUT NOTICE
SUBJECT TO AMENDMENT

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.		DESIGN	44	DRAWN BY	44	DART DART AEROSPACE USA, INC. PORT HADLOCK, MA	
CHECKED	44	APPROVED	44	DRAWING NO.	D2650	REV. E	SHEET 5 OF 5
DATE	06.03.30	TITLE	SKIDTUBE	SCALE	1:10		

RELEASED

06.03.30

ACME